
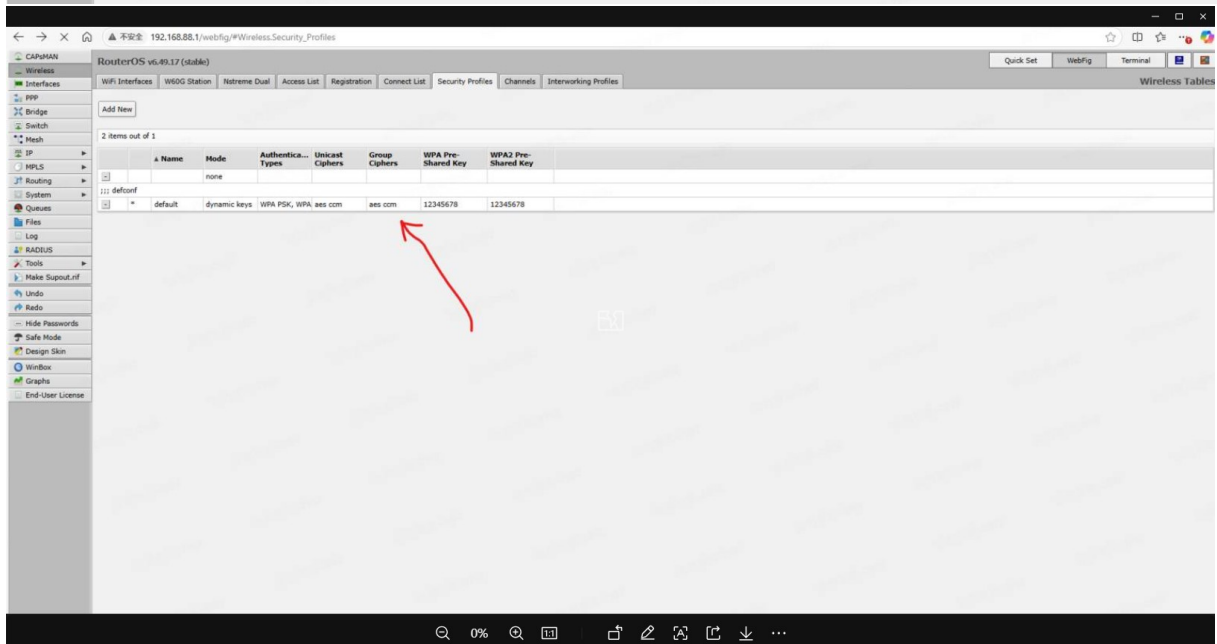


Důvody a řešení pro připojení hlavic DesignoWBwifi k některým routerům microtic jsou následující:

Krátká výdrž baterie je způsobena tím, že doba aktualizace skupinového klíče routeru nebo AP je příliš krátká (interval 5 minut) a stanice/modul je odpojen při každé aktualizaci zařízení (routeru nebo AP). Jedná se o problém konfigurace zařízení (routeru nebo AP). Problém vyřeší změna doby aktualizace skupinového klíče zařízení na 12 nebo 24 hodin. Kroky jsou níže.

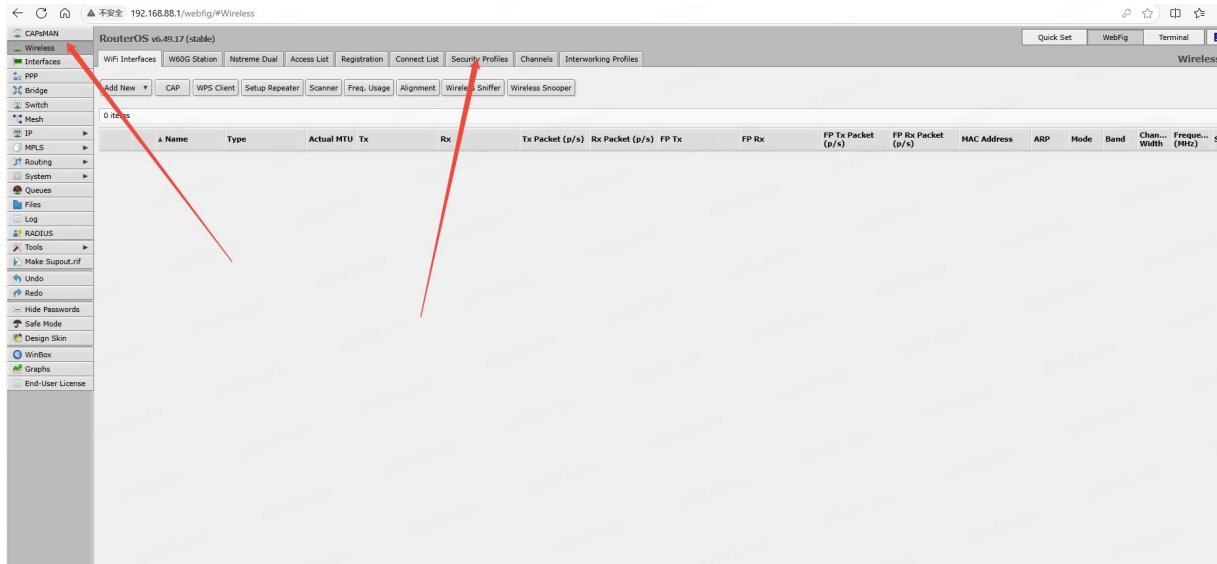

192.168.88.1/webfig/#Wireless.Security\_Profiles.0

Name	default
Mode	dynamic keys
Authentication Types	<input checked="" type="checkbox"/> WPA PSK <input checked="" type="checkbox"/> WPA2 PSK <input type="checkbox"/> WPA EAP <input type="checkbox"/> WPA2 EAP
Unicast Ciphers	<input checked="" type="checkbox"/> aes ccm <input type="checkbox"/> tkip
Group Ciphers	<input checked="" type="checkbox"/> aes ccm <input type="checkbox"/> tkip
WPA Pre-Shared Key	12345678
WPA2 Pre-Shared Key	12345678
Supplicant Identity	MikroTik
Group Key Update	00:05:00
Management Protection	disabled
Management Protection Key	
Disable PMKID	<input checked="" type="checkbox"/>
MAC Authentication	<input type="checkbox"/>
MAC Accounting	<input type="checkbox"/>
EAP Accounting	<input type="checkbox"/>
Interim Update	00:00:00
MAC Format	XX:XX:XX:XX:XX:XX
MAC Mode	as username
Called ID Format	mac:ssid
MAC Caching Time	disabled
EAP Methods	passthrough
TLS Mode	no certificates
TLS Certificate	none
MSCHAPv2 Username	
MSCHAPv2 Password	

